

Work Order ID 62285

September 24, 2010 2:44:43 PM



Page 1

Item ID: D2966-1-BENT

Accept



Setup Start



Revision ID:

Stop



Item Name: Skidtube Assembly 105

Start Date: 9/24/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/08/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: CY Date: 10/9/24 Tooling:

Date:

QC: Date: SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3274	Rev D

110

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Determine square end of tube and deburr
2-Drill #30 pilot holes using DT8678. Open holes to Ø5/16". (0.313"). Deburr holes.

120

0.00



BENDING MACHINE - SKIDTUBES

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

Bend tube as per program BO105 on CNC Bender and Dwg D2966. Use 5/16" locator pin on buggy "A".

150

QC5-Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

DP 10-10-18

1 - BE 10-10-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62285

September 24, 2010 2:44:43 PM



Page 2

Item ID: D2966-1-BENT

Accept



Setup Start



Revision ID:

Stop



Item Name: Skidtube Assembly 105

Start Date: 9/24/10 Start Qty: 1.00



Cust Item ID:

Required Date: 10/08/10 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start



QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

300

Identify as per dwg & Stock Location: LG

0.00



Packaging

Packaging

Memo

0.00

Packaging

1 - BE 10-10-18

310

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

10/10/2010
mf
10-10-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

September 24, 2010 2:44:43 PM

Page 1

Work Order ID: 62285



Parent Item: D2966-1-BENT



Parent Item Name: Skidtube Assembly 105


Start Date: 9/24/10

Required Date: 10/08/10

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP rev A 10.09.17 New issue EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2962-125  Outer Tube Extrusion		Manufactured	No				Each	28.0000	1	1			

Location

HALL

17532

Loc Qty

28

28

Loc Code

① — DP 10-10-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN RF	DRAWN BY RF	DART AEROSPACE USA, INC. BELLEVUE, WA	
CHECKED #	APPROVED #	DRAWING NO. D2966	REV. A SHEET 1 OF 2
DATE 00.03.08		TITLE BO 105 SKIDTUBE ASSEMBLY	SCALE NTS
A	00.03.08	NEW ISSUE	

RELEASED
00.05.11 #

Qty	Part Number	Description
X	D2966-041	SKIDTUBE ASSEMBLY
1	D2962-125	EXTRUSION
1	D2964	CAP
1	D2965	CAP
1	D2970-1	WEARPLATE
1	D2970-3	WEARPLATE
1	D2971	CROSS BOLT SPACER
7	D2973	CROSS BOLT SPACER
1	D2976	WEB
36	ALS7-1032-130 or ALS4-1032-130 or AKS7-1032-130 or AKS4-1032-130	INSERT
28	AN960JD10L	WASHER
26	MS27039-1-08	SCREW
2	MS27039-1-09	SCREW
1	D3176-1	BUSHING
1	D3176-3	NUT

UNCONTROLLED COPY
ADDED TO DOCUMENT
WITH CHANGE
WORK ORDER
NO. 62285
C2109/24



GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) WELDING TO BE DONE PER DART QSI 004.
- 3) INSERT D2976 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- 4) USE DART DRILL TEMPLATE DT8451 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION B-B (34 PLACES) AFTER FINISH. SEAL WEARPLATE SCREWS WITH SIKAFLEX-241/-291.
- 5) DO NOT INSTALL MS27039-1-08 SCREWS AND AN960JD10L WASHERS IN THESE LOCATIONS.
- 6) INSTALL ALS7-1032-130 INSERT, MS27039-1-08 SCREW, AND AN960JD10L WASHER IN 2 PLACES THIS LOCATION BEFORE POWDER COATING.
- 7) FINISH:

ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2976 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.6.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART
QSI 005 4.4 (OPTIONAL) BLACK SANDTEX (REF 4.3.5.7)




01.01.29
CP 01.01.30

A2	02.10.30	ADD D3176-1/-3	# CP
A1	01.01.29	CHANGE COLOR TO BLACK SANDTEX	# CP


Copyright © 2000 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DETAIL A
SCALE 1:3

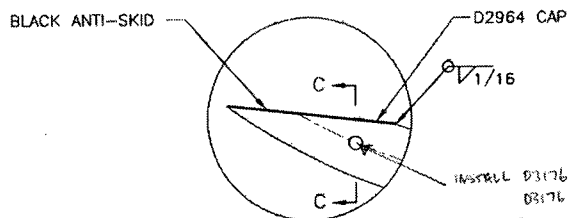


SECTION B-B
SCALE 1:6

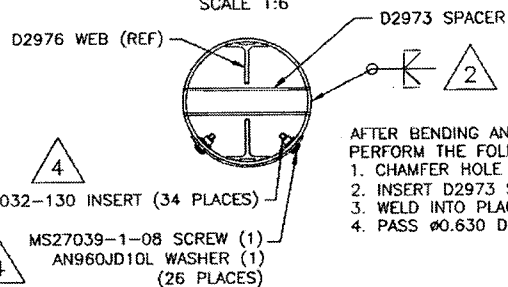

ALS7-1032-130 INSERT (34 PLACES)


MS27039-1-08 SCREW (1)
AN960JD10L WASHER (1)
(26 PLACES)

SECTION C-C
SCALE 1:6

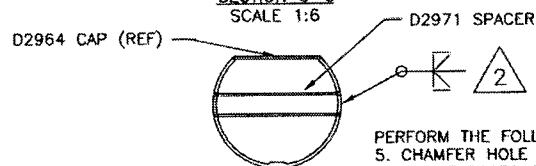


PERFORM THE FOLLOWING FOR Ø0.625 HOLES ONLY:
5. CHAMFER HOLE 0.030 x 45°
6. INSERT D2971 SPACER
7. WELD INTO PLACE AND GRIND FLUSH
8. PASS Ø0.484 DRILL TO REMOVE SPILL OVER
Ø0.750


DETAIL D
SCALE 1:4

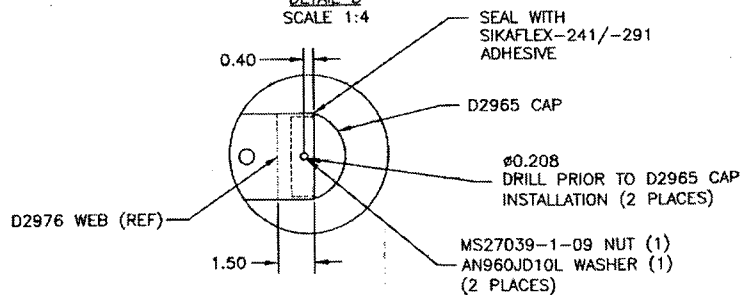


D2966-1 BENDING/CUTTING DETAIL

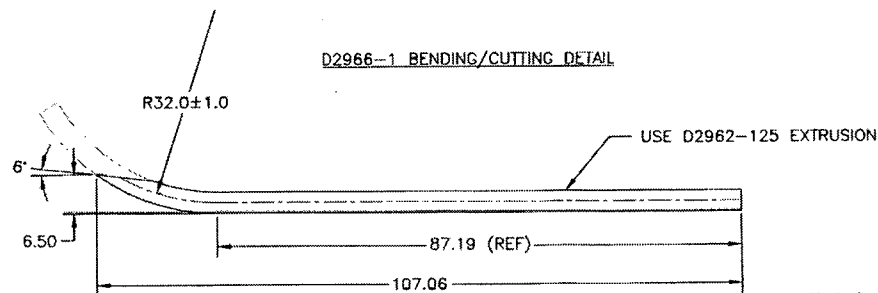

D2966-1 DRILLING DETAIL

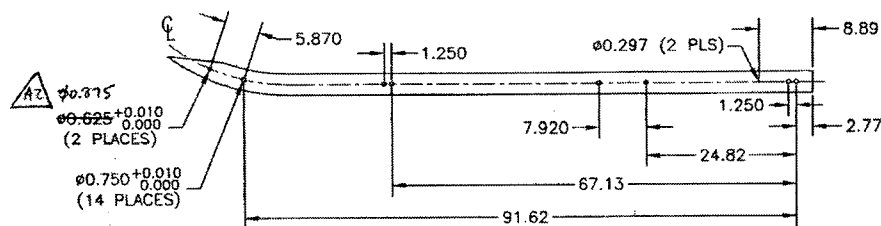

D2966-041 ASSEMBLY DETAIL

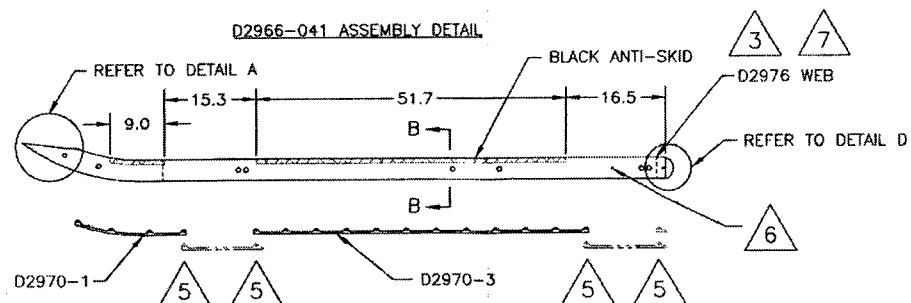

COPYRIGHT © 2000 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN RF	DRAWN BY RF
CHECKED A	APPROVED A
DATE 00.03.08	

DART DART AEROSPACE USA, INC. BELLINGHAM, WA	REV. A SHEET 2 OF 2
DRAWING NO. D2966	SCALE 1:20
TITLE BO 105 SKIDTUBE ASSEMBLY	